Art. "B"

G

1/2"

3/4"

1''

1"1/4

1"1/2

2"

DIFFERENTIAL PRESSURE CHART

NC : NBR-FPM-EPDM

DeltaP

bar

8

7

5.5

8

5

NC : PTFE

DeltaP G bar 1/2" 8 3/4" 5 1'' 6 1"1/4 4.5 1"1/2 6 2" 3.5

DA/NO: NBR-FPM-EPDM


PILOT DeltaP PRESS. G bar 15 1/2" 4 1/2" 19 3/4" 10 13 3/4" 5 1" 4 18 1" 5 23 1"1/4 11 4 1"1/4 5 14 1"1/2 11 4 1"1/2 5 13 4 2" 5

DA/NO: PTFE

	PILOT	DeltaP		
G	PRESS.	bar		
1/2"	4	15		
1/2"	5	19		
3/4"	4	8		
3/4"	5	11		
1''	4	15		
1''	5	20		
1''1/4	4	9		
1''1/4	5	12		
1"1/2	4	10		
1"1/2	5	12		
2"	4	6		
2"	5	8		

MINIMUM PRESSURE REQUIRED TO OPEN NC VERSION

G	1/2"	3/4"	1''	1"1/4	1''1/2	2"
Bar	4.5	4.5	3.5	3.5	4	4

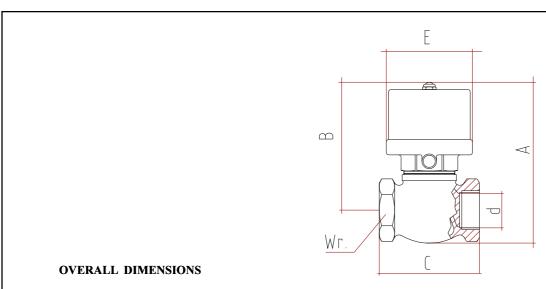

DN	G	А	В	C	d	E	Wrench	Κv	Weight
mm.		mm.	mm.	mm.	mm.	mm.	mm.	m3/h	дг.
15	1/2"	106	86	60	17	50	27	3.4	590
20	3/4"	110	85	74	24	50	35	7.9	700
25	1''	128	98	85	30	76	46	11	1400
32	1"1/4	138	106	95	39	76	52	18	1650
40	1"1/2	166	130	110	45	89	60	28	2600
50	2"	184	139	120	55	89	72	44	3400